


FLASHING SHINGLE-TO-SHINGLE TRANSITIONS - SECTION VIEW

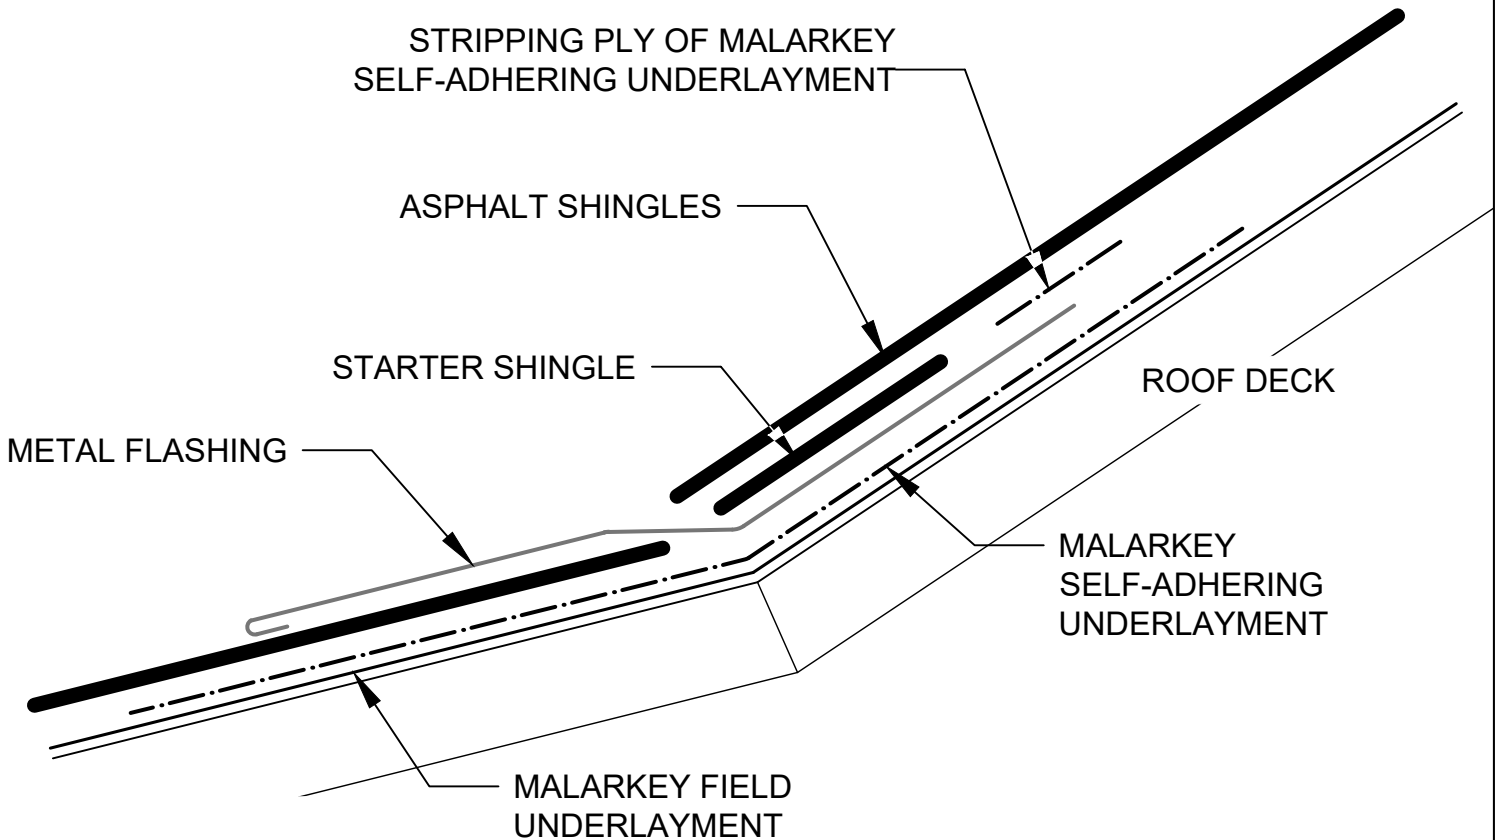

NOTES:

- OVER TRANSITION CHANGE, INSTALL MINIMUM HALF-WIDTH, MALARKEY SELF-ADHERING UNDERLAYMENT; CENTER OVER TRANSITION BREAK.
- SHINGLE UP TO THE TRANSITION BREAK.
- INSTALL 26 GA. CORROSION-RESISTANT METAL FLASHING (HEMMED EDGE ON DOWN-SLOPE SIDE IS OPTIONAL):
 - LAP LOWER FLANGE OVER SHINGLES ON THE DOWN-SLOPE SIDE; SECURE WITH GASKETED FASTENERS; SEAL JOINTS WITH A BEAD OF SEALANT.
 - NAIL UPPER FLANGE TO THE DECK ON THE UP-SLOPE SIDE.
 - STRIP-OFF UPPER FLANGE WITH MINIMUM 6"-WIDE (152 MM) MALARKEY SELF-ADHERING UNDERLAYMENT TO COVER FASTENERS: 3" (76 MM) ON THE FLANGE, 3" (76 MM) ON THE FIELD.
- RESUME SHINGLING UP THE ROOF OVER THE UPPER FLANGE OF THE FLASHING; AS YOU WOULD AT THE EAVE, BEGINNING WITH A STARTER SHINGLE.

STEEP SLOPE 31A - SEC



Rev. 1/21

PROJECT NAME:

ADDRESS:

OWNER:

DATE:

SCALE: NOT TO SCALE

PROJECT NO:

DRAWING NO. :

SUBMITTAL NO. :