


3-TAB METAL "W" VALLEY

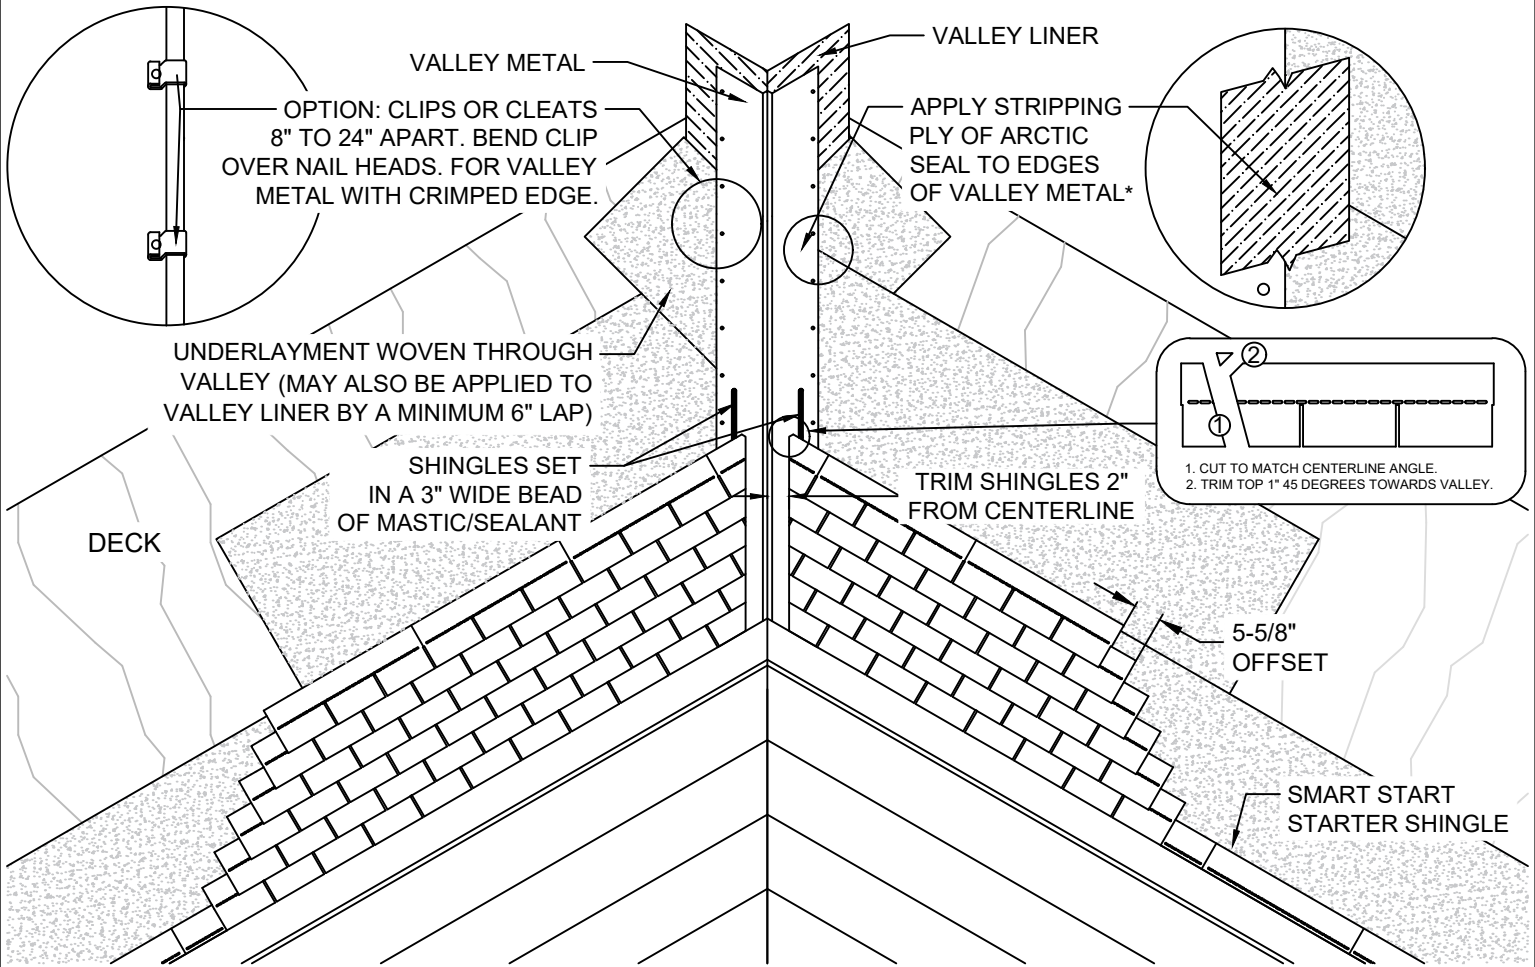


NOTES:

- VALLEY METAL FLASHING USED WITH MALARKEY SHINGLES MUST BE MINIMUM 24" WIDE AND 26 GAUGE.
- SECURE VALLEY METAL WITH FASTENERS NO MORE THAN 1" FROM THE OUTSIDE EDGES AND SPACED 10"-12" ON CENTER.
- SET OVERLAPPING ENDS OF VALLEY METAL IN A UNIFORM LAYER OF SEALANT WITH A MINIMUM 4" LAP. DO NOT FASTEN THE LAP.
- NAIL SHINGLES NO CLOSER THAN 6" FROM VALLEY CENTERLINE.

*A CONTINUOUS, MINIMUM 6"-WIDE STRIPPING PLY OF ARCTIC SEAL MAY BE APPLIED TO BOTH EDGES OF THE VALLEY METAL FOR ADDITIONAL SEALING.

STEEP SLOPE 14

	PROJECT NAME:	DATE:
	ADDRESS:	SCALE: NOT TO SCALE
	OWNER:	PROJECT NO:
		DRAWING NO. :
		SUBMITTAL NO. :